

Manhole Inspection Summary

Manhole # S15II1023MH

Printed On: 12/17/2008

Page 1 of 5

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **15II1** Node: **023** Status: **Found**

Insp Date: **6/15/07 10:29 AM**

Incomplete Comments

Crew: **IB, FW**
Inspector: **Bailey, I**
Firm: **PER**

Location Address: **2431 COLD SPRING LN**

Cross Street: **GREENSPRING AVE**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments **CHANNEL OFFSET 2' TO RIGHT OFF MH..**

Cover

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **2** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **12** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Corbel

Material: **Brick and Concrete**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Barrel

Material: **Brick and Concrete**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Bench

☒ Exists Material: **Brick**

☐ Parged

☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **4**

Missing: **2**

☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge

Depth:

(ft.)

☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S15II1023MH

Printed On: 12/17/2008

Page 2 of 5

Location View



Top View



Corroded and missing steps. Bench debris.

Defect



Corbel and Barrel infiltration.

Defect



Frame leaks. Frame offset. Adjustment deterioration and infiltration.

Defect



Corbel deterioration and infiltration

Defect



Corroded and missing steps. Corbel and Barrel infiltration.

Manhole Inspection Summary

Manhole # S15II1023MH

Printed On: 12/17/2008

Page 3 of 5

8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.42** (ft.) Flow Characteristics: **Fast**

Deposits: ☐ None ☐ Mud ☐ Sludge ☐ Debris ☒ **Grease**

Silt Depth: **0** (in.) Deposits Extent: **Light**

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

6 in. Circular Gravity Sewer Pipe In @ 3 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.80** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ **Grease**

Silt Depth: (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

Manhole Inspection Summary


Manhole # S15II1023MH

Printed On: 12/17/2008

Page 4 of 5

6 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock

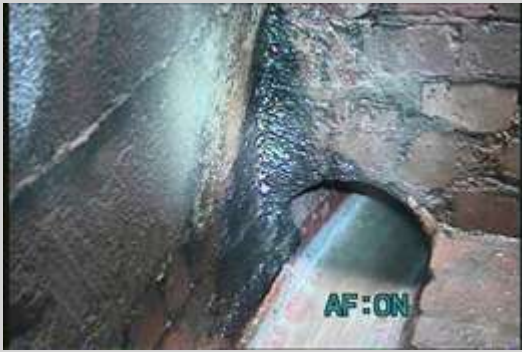

Barrel infiltration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.50** (ft.) Flow Characteristics: **Fast**

Deposits: ☐ None ☐ Mud ☐ Sludge ☐ Debris ☒ Grease

Silt Depth: **0** (in.) Deposits Extent: **Light**

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

6 in. Circular Gravity Sewer

Pipe In @ 7 O'Clock



Rod and Bar (Angled)

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: **7.60** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S15II1023MH

Printed On: 12/17/2008

Page 5 of 5

6 in. Circular Gravity Sewer
Pipe In @ 9 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.60** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection